

LEVEL CONTROL RELAYS HNM, HNE

84870710

HNE * OBSOLETE PRODUCT

- Control of one or two levels
- Filling/emptying function
- HNM resistive sensor
- HNE digital sensor * obsolete



PRODUCT DESCRIPTION

The control relays HNM and HNE are used for level control.

HNM: Used for conducting liquids. Measures levels with resistive sensors. The principle is based on measurement of the apparent resistance between two recessed electrodes. When this value is less than the limit value indicated at the front, the relay output changes over. To avoid electrolysis, AC is applied to the electrodes.



HNE: *Now obsolete* Controls the levels of non-conducting and conducting materials using input/output sensors (NPN, PNP) that detect high or low level. Green LED indicates supply voltage and yellow LED indicates active relay output. If the LEDs flash, this indicates incorrect setting.

A rotary switch on the front is used for selecting the measurement range and filling/emptying function. With another switch, the number of levels can be set (1 or 2) and the type of delay if the function position for 1 level has been selected. The positions of these switches are registered when the operating voltage is switched on. If the switch is in the wrong position, the relay will remain deactivated and the LEDs will flash to indicate incorrect setting. If the switch position is changed during operation, all LEDs begin to flash but the unit will continue to function normally with the function that was set at the most recent power connection. The LEDs return to normal function when the switch has been returned to its original position, which was set before the first power connection. Green LED (Un) indicates supply voltage OK. Yellow LED (R) indicates active relay output.

TECHNICAL DATA

Approvals	CE, CSA, RoHS, UL
Breaking capacity	5A, 250V AC/DC
Function	Level Control
Input	Discrete Sensor
IP class connection	IP20
IP class housing	IP30
Mounting	35 mm DIN-Rail
Output	Relay 1 pole C/O
Power consumption	5 VA / 2.7 W

Sensor cable length max	100 m
Storage temperature max	70 °C
Storage temperature min	-40 °C
Supply voltage	24-240V AC
Temperature operational max	50 °C
Temperature operational min	-20 °C
Time delay startup	0.6 s
Time delay when exceeding the limit value	0,1-5s
Weight	115 g

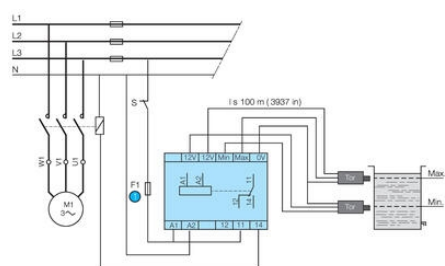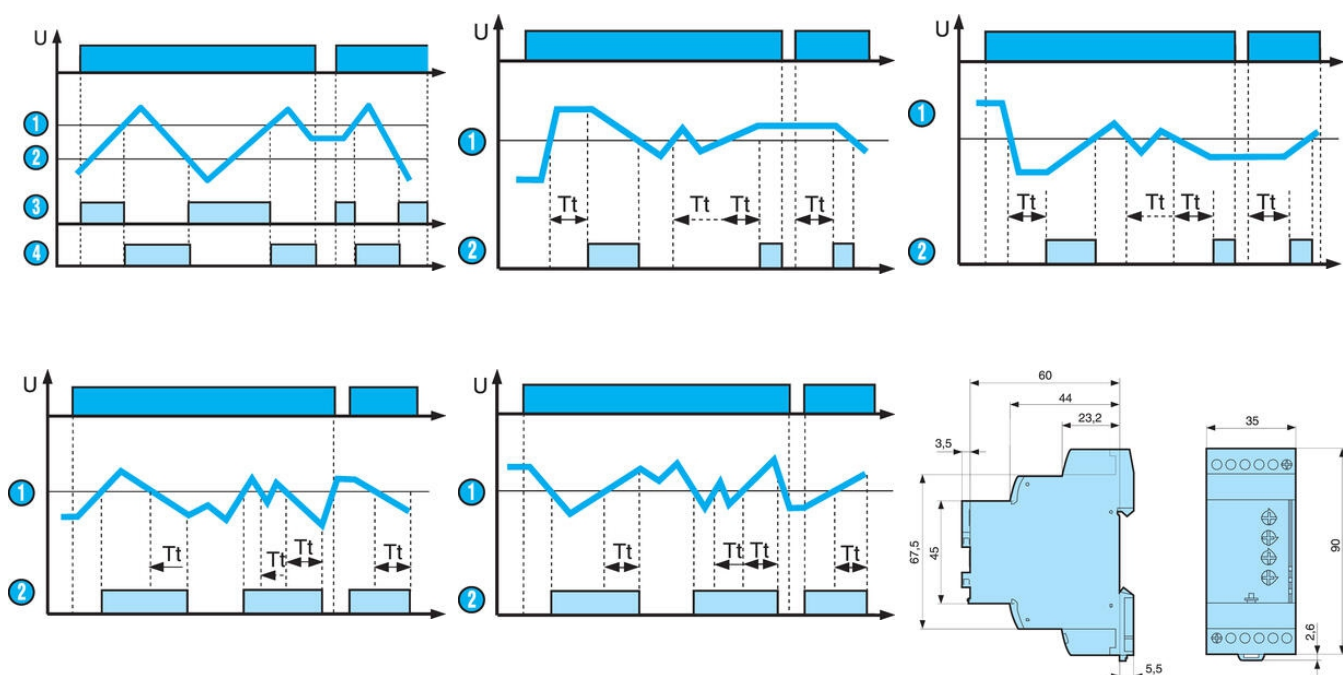

● Ultrasnabb säkring 1 A eller fränskiljare